

## CR-D\*\* Type Cable Glands featuring CROCLOCK® – ASSEMBLY INSTRUCTIONS

### Brief Description


Peppers CR-D\*\* type cable glands featuring Crocklock® universal armour clamping are for outdoor use in appropriate Hazardous Areas with armoured, unarmoured, braided and screened cable. They provide a displacement seal on the inner sheath and give environmental protection to IP66/67/68 (50 metres for 7 days). A termination suitable for EMC protection can be made using armoured cables with this gland.

### Warning

Please read these instructions carefully. These products should not be used in applications except as detailed here or in our datasheets, unless confirmed in writing by Peppers. Peppers take no responsibility for any damage, injury or other consequential loss caused where products are not installed or used according to these instructions. This leaflet is not intended to advise on the selection of product. Further guidance can be found in the standards listed overleaf or the prevailing code of practice.

### STEP-BY-STEP INSTRUCTIONS

#### SPLIT GLAND

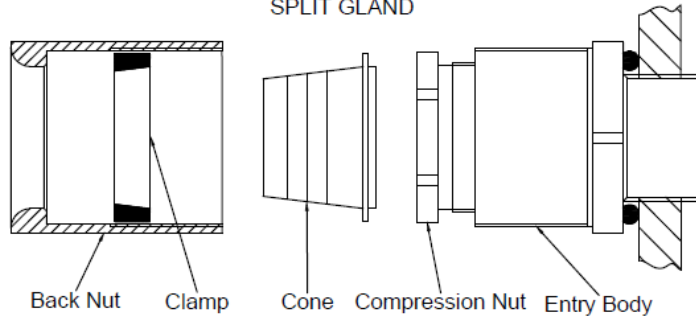

#### CABLE PREPARATION



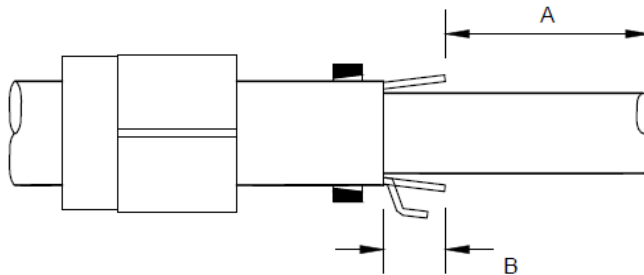


TABLE 1	
GLAND SIZE	ARMOUR LENGTH "B"
16 - 25	20 mm
32 - 40	30 mm
50S - 75	32 mm
80 - 100	50 mm

#### ARMOUR CLAMPING

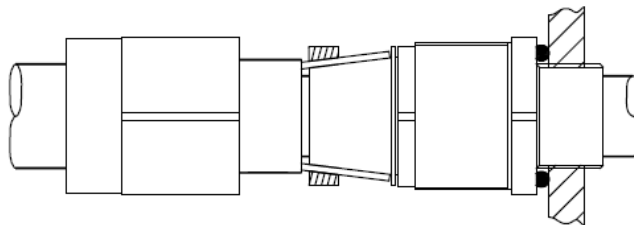

#### COMPLETED INSTALLATION

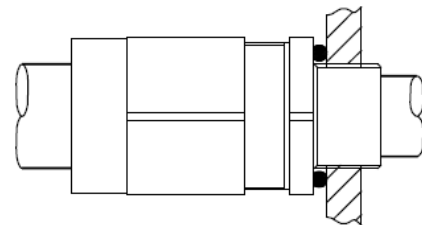

### STEP-BY-STEP FITTING INSTRUCTIONS

1. Split gland as shown.
2. Fit Entry Body, allowing for any installation accessories, and fully engage the thread into the equipment. Hand-tighten, then suitably secure with a wrench. Further guidance can be found in Peppers document CT0030 which can be found on our website.
3. Slide Back Nut and Clamp (and shroud if required) onto cable as shown.
4. Prepare Cable
  - A. Strip outer jacket and armour length to suit installation. On CR-D2\*\*/CRD-4\*\* options (lead sheathed cable) the lead sheath must pass through the Continuity Washer when installation is complete (the Continuity Washer is fitted under the Compression Nut)
  - B. Expose armour. For approximate lengths see Table 1. Where sheath sizes are near minimum, form armour to facilitate clamping as shown.
5. Slide the Clamp over the exposed armour. Ensure the Clamp is in the correct orientation.
6. Slide Cone onto inner sheath and under armour. Slide Clamp onto exposed armour
7. For lead sheathed cable - Unscrew the Compression Nut, remove the Continuity Washer and replace the nut.  
For all cables - Insert cable through Entry Body. Push cable forward to maintain armour contact.
8. To clamp armour/braid onto Cone, hand-tighten Back Nut to Entry Body. Support the cable to prevent it from twisting then using a wrench, tighten an additional 1 turn. For cable with maximum diameter wire armour it may be necessary to remove the Internal Skid Washer located under the Compression Nut first and tighten an additional ½ to 1 turn to facilitate clamping.
9. Loosen off Back Nut to visually check armour is securely locked. If armour has not clamped repeat the clamping process.  
For lead sheathed cable - Replace Continuity Washer. Reinsert cable.  
For all cables - Replace Skid Washer if removed and reinsert cable. Tighten the Compression Nut so that seal makes full contact with cable sheath and then tighten by the additional turns detailed in Table 2.
10. Re-tighten Back Nut by hand until tight, then tighten an additional 1 turn for cable with wire armour, or an additional ¼ turn for all other armour types with a wrench. If fitted, pull shroud over gland assembly.

## CR-D\*\* Type Cable Glands featuring CROCLOCK® – ASSEMBLY INSTRUCTIONS

Table 2 – Installation Data, Cable Sizes and Armour Acceptance (mm)

Gland Size	Compression Nut Turns – Step 9	Inner Sheath		Outer Sheath		Armour Acceptance Ranges	
		Min.	Max.	Min.	Max.	Min.	Max.
16	1	3.4	8.4	-	16.0	0.15	1.25
20S	1	7.2	11.7	-	16.0	0.15	1.25
20	1	9.4	14.0	-	21.0	0.15	1.25
25	1	13.5	20.0	-	27.5	0.15	1.6
32	1	19.5	26.3	-	34.0	0.15	2.0
40	1	23.0	32.2	-	40.6	0.2	2.0
50S	1	28.1	38.2	-	53.2	0.2	2.5
50	1	33.1	44.1	-	53.2	0.3	2.5
63S	1	39.2	50.1	-	65.8	0.3	2.5
63	1	46.7	56.0	-	65.8	0.3	2.5
75S	1 ¾	52.1	62.0	-	78.0	0.3	2.5
75	1 ¾	58.0	68.0	-	78.0	0.3	2.5
80	1 ¾	62.2	72.0	-	90.0	0.45	3.15
85	1 ¾	69.0	78.0	-	90.0	0.45	3.15
90	1	74.0	84.0	-	102.0	0.45	3.15
100	1	82.0	90.0	-	102.0	0.45	3.15

### Approvals and Certification

Approval	Certificate Number	Protection Concept / Type
ATEX (2014/34/EU)	CML 19ATEX1348X / CML 21UKEX1030X	Ex II 1D 2G Ex db IIC Gb / Ex eb IIC Gb / Ex ta IIIC Da
UKCA (SI 2016 No. 1107)	CML 19ATEX4109X / CML 21UKEX4043X	Ex II 3G Ex nR IIC Gc
IECEX	IECEX CML 19.0106X	Ex db IIC Gb / Ex eb IIC Gb / Ex nR IIC Gc / Ex ta IIIC Da
CSA	1356011	Ex db IIC Gb / Ex eb IIC Gb / Ex ta IIIC Da Class I Zone 1 AEx eb IIC Gb / Zone 20 AEx ta IIIC Da CL II Gr EFG / CL III Type 4X / IP66 IP68
INMETRO	NCC 13.2185X	Ex db IIC Gb / Ex eb IIC Gb / Ex nR IIC Gc / Ex ta IIIC Da
EAC	PPOMMAW TECT RU C-GB.AK58.B.05106	1Ex db IIC Gb X / 1Ex eb IIC Gb X / 2Ex nR IIC Gc X / Ex ta IIIC Da X
UKRAINE	CU 18.0326 X	II 1D 2G 3G Ex db IIC Gb / Ex eb IIC Gb / Ex nR IIC Gc / Ex ta IIIC Da
CCC	2021312313000409	Ex db IIC Gb / Ex eb IIC Gb / Ex nR IIC Gc / Ex ta IIIC Da IP66
Korea	15GA4BO-0669X / 15GA4BO-0670X	Ex d IIC / Ex e IIC
CCoE (PESO)	P494321/8 & P494321/13	Ex db IIC Gb / Ex eb IIC Gb / Ex ta IIIC Da / Ex nR IIC Gc
ECASEx	25-06-153223/E25-06-159811/NB0007	Ex db IIC Gb / Ex eb IIC Gb / Ex ta IIIC Da / Ex nR IIC Gc
ABS	25-0158110-PDA	Specified ABS Rules – See certificate
Lloyd's Register	LR2124442TA	Ex db IIC Gb / Ex eb IIC Gb / Ex nR IIC Gc / Ex ta IIIC Da
DNV	TAE00004XK	Ex db IIC Gb / Ex eb IIC Gb / Ex nR IIC Gc / Ex ta IIIC Da

### Installation Guidance

Point	Advice
1	BS/EN/IEC 60079-10      BS/EN/IEC 60079-14      National Electrical Code (NEC 500-505)      Canadian Electrical Code (CSA C22.1)
2	Installation should only be carried out by a competent electrician, skilled in cable gland and appropriate electrical installations.
3	Comprehensive details of the compliance standards can be found in the product certificates which are available for download from our website.
4	NO INSTALLATION SHOULD BE CARRIED OUT UNDER LIVE CONDITIONS.
5	Threaded entries: the product can be installed directly into threaded entries. Threaded entries should comply with the relevant applicable standards and have a lead-in chamfer to allow for full engagement of the threads. Failure to provide a sufficient lead-in chamfer may lead to ingress sealing issues. For Ex db applications a minimum of 5 fully engaged threads is required.
6	Clearance holes: these shall be no larger than 0.7mm above the nominal diameter of the external entry thread. The product should be secured with a Peppers locknut and then tightened to ensure the cable gland is secure. Where no integral sealing method is provided a Peppers sealing washer should be used to maintain IP ratings. A Peppers serrated washer should be used for additional installation protection. Peppers does not recommend using tapered threads in clearance holes.
7	Ingress protection: to maintain the Ingress Protection rating of the product, the entry hole must be perpendicular to the surface of the enclosure. The surface should be clean, dry and must be sufficiently flat and rigid to support the assembly and make the IP joint. Metric threads are supplied with an O-ring and will maintain IP66 and IP68. Other parallel entry threads will maintain an IP rating of IP64. A Peppers sealing washer should be used to maintain all IP ratings greater than IP64. Whilst Peppers products with tapered threads, when installed into a threaded entry, have been tested to maintain IP66 without any additional sealant, due to the differing gauging tolerances associated with the use of tapered threads it is recommended to use a non-hardening thread sealant if an IP rating higher than IP64 is required. Any thread sealant used should be suitable for use in the hazardous area or location where the equipment is installed, have a suitable temperature range for the temperature at the point of mounting, not contain evaporating solvents and not cause corrosion at the threaded interface when used with dissimilar materials. The product incorporates a thread run out according to general machining techniques and will not have a full form thread for the entire length. Threaded entries should have a suitable lead-in chamfer to ensure a seal is maintained, further guidance can be found on Peppers website. It is the user's/installer's responsibility to ensure that the interface between the enclosure and cable gland is suitably sealed for the required application.
8	Where a bonding connection to earth is required a Peppers earth tag should be used. Peppers earth tags have been independently tested to comply with the Category B values given in IEC 62444. Peppers earth tags should be fitted over the external entry thread from either inside or outside the enclosure. If fitted internally they must be secured with a Peppers locknut and optionally a Peppers serrated washer. Further guidance can be found in Peppers document CT0170 which can be found on our website.
9	Peppers external metric entry threads comply with ISO 965-1 & ISO 965-3 with a 6g tolerance fit. The standard metric thread pitch is 1.5mm for threads up to M75 and 2.0mm for size M80 and above. Alternative thread pitches are available upon request. Peppers external NPT threads comply with ASME B1.20.1 with gauging to clause 8.1. All threads comply with the threaded joint requirements of clause 5.3 from IEC 60079-1. Information on other thread types can be found in the product certificates.
10	Once installed do not dismantle except for routine inspection. An inspection should be conducted as per IEC 60079-17. After inspection the gland should be re-assembled as instructed, ensuring the compression nut, mid cap and back nut are correctly tightened to ensure the cable is secure.
11	If required an anti-seize lubricant may be used to aid assembly and routine inspection, if used care should be taken to ensure no lubricant comes into contact with the cable gland seals as this may impair performance. Any lubricant used should comply with the prevailing code of practice, be suitable for use in the hazardous area or location where the equipment is installed, have a suitable temperature range and not contain evaporating solvents.

### Interpretation of Markings

Markings on the outside of this gland carry the following meanings: Cable Gland Size & Type CR-D-a-b-ccc-ddd-nn.

a =	Seal Type	1 = Neoprene (black)	2 = Neoprene with Continuity Washer	ccc =	Gland size
		3 = Silicone (white)	4 = Silicone with Continuity Washer	ddd =	Entry thread type and size
b =	Main component material	B = Brass	S = Stainless Steel	nn =	Year of manufacture

### Specific Conditions of Use

- CR-D\*\* glands must not be used in enclosures where the temperature at the point of contact is outside the range of -35°C to +90°C using neoprene seals, or -60°C to +180°C using silicone seals.
- When CR-D\*\* glands are used with increased safety and/or dust protected equipment, the entry thread shall be suitably sealed to maintain the ingress protection rating of the associated equipment.
- If CR-D\*\* glands only grip the cable sheath and do not clamp the cable armour or if they are used to terminate unarmoured, braided or screened cables, then they shall only be used for fixed installations, and the cables shall be effectively clamped to prevent pulling or twisting.
- When installed in accordance with these instructions within appropriate equipment, CR-D\*\* glands are capable of providing an ingress protection of IP66 and IP68 (50 metres - 7 days).
- When used in explosive dust atmospheres and installed in threaded entries without interface O-ring seals, CR-D\*\* glands shall only be fitted into enclosures that have either:
  - parallel entries that will ensure a minimum of 5 full threads of contact will be maintained, this is in accordance with clause 5.1.2 of IEC 60079-31.
  - tapered entries that will ensure a minimum of 3 ½ full threads of contact will be maintained, this is in accordance with clause 5.1.2 of IEC 60079-31.